



EXISTING RAMP UP TO WAREHOUSE AND DOCK - BREEZEWAY ENTRANCE BETWEEN OFFICE AND WAREHOUSE
TAKEN 03/19/25



INTERIOR OF WAREHOUSE LOOKING OUT TOWARDS DOCK
TAKEN 03/12/25



EXISTING FREEZER ENTRANCE
TAKEN 03/12/25



EXISTING FREEZER AND WAREHOUSE STORAGE
TAKEN 03/12/25

4. PUBLIC TELEPHONES
THERE ARE NO PUBLIC PAY OR PUBLIC COURTESY TELEPHONES PROVIDED ON SITE. THE WAREHOUSE HAS AN OFFICE TELEPHONE FOR RECEIVING.

5. DRINKING FOUNTAINS
THERE IS NO DRINKING FOUNTAIN PROVIDED AT THE WAREHOUSE. THE WAREHOUSE HAS A BOTTLE FILLER THAT IS PROVIDED AT AN ACCESSIBLE HEIGHT. THE BOTTLE FILLER WOULD NEED TO BE REMOVED AND REPLACED WITH A DRINKING FOUNTAIN/BOTTLE FILLER COMBO AT AN ACCESSIBLE HEIGHT.



EXISTING WATER BOTTLE FILLER IN WAREHOUSE - A CODE COMPLIANT DRINKING FOUNTAIN AND BOTTLE FILLER TO BE INSTALLED
TAKEN 03/12/25

6. PARKING
PARKING IS PROVIDED IN FRONT OF THE OFFICE BUILDING WITHOUT ANY ACCESSIBLE STALLS. THE AREA IN FRONT OF THE OFFICE WILL NEED TO BE RE-GRADED TO PROVIDE A LEVEL ACCESSIBLE VAN STALL WITH ACCESS AISLE TO CONNECT TO THE NEW RAMP.



ENTRANCE TO LOWER OFFICE BUILDING - CURRENTLY THERE ARE NO ACCESSIBLE PARKING IN FRONT OF THE OFFICE BUILDING - ASPHALT WILL NEED TO BE MODIFIED TO PROVIDE LEVEL PARKING AND AISLE
TAKEN 03/12/25



ENTRANCE TO LOWER OFFICE BUILDING - CURRENTLY THERE ARE NO ACCESSIBLE PARKING IN FRONT OF THE OFFICE BUILDING - ASPHALT WILL NEED TO BE MODIFIED TO PROVIDE LEVEL PARKING AND AISLE
TAKEN 03/12/25

7. SIGNS
DOORS CURRENTLY DO NOT HAVE CODE COMPLIANT SIGNS. EACH DOOR ALONG THE PATH OF TRAVEL WILL REQUIRE CODE COMPLIANT BRAILLE FOR IDENTIFYING, AND ACCESSIBLE SYMBOL AND EXIT SIGNAGE WHERE APPLICABLE - REFER TO IMAGES OF DOORS IN PHOTOS.

PATH OF TRAVEL IMPROVEMENTS - CONT'D.

3. AT LEAST ONE RESTROOM FOR EACH GENDER OR ALL-GENDER RESTROOM FOR EACH USER GROUP
THERE ARE NO EXISTING RESTROOMS IN THE WAREHOUSE, BUT THERE ARE TWO EXISTING RESTROOMS IN THE OFFICE BUILDING. BY INSTALLING THE NEW RAMP TO CONNECT THE WAREHOUSE TO THE OFFICE BUILDING, ONE OF THE EXISTING RESTROOMS CAN BE MODIFIED TO MEET CURRENT CODE REQUIREMENTS. THIS INCLUDES REMOVING THE CURRENT LAVATORY AND RE-LOCATING IT TO THE SIDE WALL SO THAT IT DOES NOT IMPEDE INTO THE WATER CLOSET CLEARANCE AND REINSTALLING GRAB BARS, SOAP DISPENSER, MIRROR AND OTHER ACCESSORIES TO MEET CODE. THE EXISTING WATER CLOSET IS CURRENTLY COMPLIANT. THE EXISTING DOOR WILL NEED TO BE MODIFIED TO SWING INTO THE RESTROOM INSTEAD OF OUT. AN EXISTING WALL POP OUT IN THE CORRIDOR WILL NEED TO BE REMOVED.



EXISTING RESTROOM DOOR ENTRANCE - DOOR SWING TO BE MODIFIED TO SWING IN - WALL POP OUT IN CORRIDOR TO BE REMOVED - DOOR IS MISSING CODE REQUIRED ROOM ID SIGNAGE
TAKEN 03/12/25



EXISTING RESTROOM DOOR ENTRANCE - DOOR SWING TO BE MODIFIED TO SWING IN - WALL POP OUT IN CORRIDOR TO BE REMOVED
TAKEN 03/12/25




EXISTING RESTROOM - LAVATORY IMPEDES INTO THE WATER CLOSET CLEAR FLOOR SPACE AND WILL NEED TO MOVE TO SIDE WALL. RESTROOM ACCESSORIES WILL NEED TO BE REINSTALLED TO MEET CODE DIMENSIONS. WATER CLOSET LOCATION IS COMPLIANT.
TAKEN 03/12/25



EXISTING RESTROOM - LAVATORY IMPEDES INTO THE WATER CLOSET CLEAR FLOOR SPACE AND WILL NEED TO BE REINSTALLED AT SIDE WALL. RESTROOM ACCESSORIES WILL NEED TO BE REINSTALLED TO MEET CODE DIMENSIONS. WATER CLOSET LOCATION IS COMPLIANT.
TAKEN 03/12/25



EXISTING WATER CLOSET LOCATION
TAKEN 03/12/25

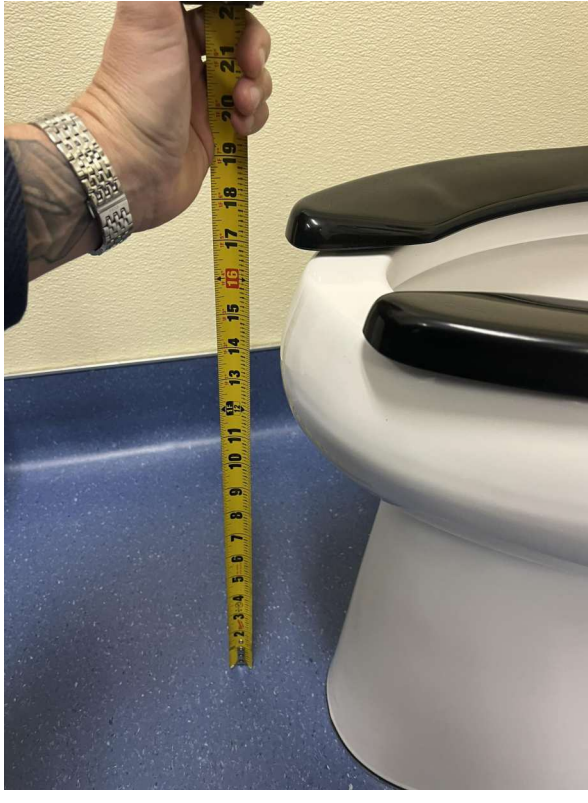

EXISTING WATER CLOSET LOCATION
TAKEN 03/12/25

PREPARED FOR THE

BOARD OF EDUCATION
NATIONAL SCHOOL DISTRICT
NATIONAL CITY, CALIFORNIA

PREPARED BY

SGPA ARCHITECTURE
AND PLANNING

REQUEST FOR UNREASONABLE HARDSHIP

CENTRAL WAREHOUSE
FREEZER REPLACEMENT
FREEZER REPLACEMENT
1400 N AVENUE
NATIONAL CITY, CA 91950

SUBMITTALS / REVISIONS		
#	ISSUE	DATE
1	DSA SUBMITTAL V1	03/19/2025
2	DSA BACKCHECK	04/30/2025
BID SET 5/1/2025 NOT FOR CONSTRUCTION PROJECT STILL IN REVIEW		
PROJECT NO. 22439-E-02		
SHEET NO.		